



1200 E. 151st Street
Olathe, KS 66062
913-397-8200

AVIATION SERVICE DOCUMENT NOTIFICATION

TO: G1000® King Air 200 and 300 Series Aircraft Owner and Operators
DATE: September 25, 2023
SUBJECT: Corrective Action for G1000 King Air 200 and 300 Series Aircraft with CVR Interface
CERTIFICATION AUTHORIZATION: STC SA01535WI-D

COMPLIANCE

MANDATORY: STC Service Bulletin 22095 must be accomplished at the next maintenance interval or biennial inspection, no later than October 31, 2023.

PURPOSE

Cross-side audio is not provided by GMA™ #1 to the optional third-party CVR. This service bulletin approves G1000 System Software Version 2286.15 as a required corrective action for this CVR interface non-compliance issue.

Please contact your local Garmin Avionics Dealer (<http://www.garmin.com/dealers/>) for additional information or for questions regarding this notification. This service notification and associated bulletin/advisory product changes can only be implemented through Garmin's authorized dealer and service center network. This document is not a substitute for and cannot be used in lieu of the document(s) referenced above for airworthiness approval.



1200 E. 151st Street
Olathe, KS 66062
913-397-8200

PRODUCTS AFFECTED

Textron Aviation Inc. (Beechcraft) King Air models 200, 200C, A200, A200CT, B200, B200C, B200GT, B200CGT, 300, 300LW, B300, and B300C aircraft equipped with G1000 NXi Integrated Flight Deck installed per STC SA01535WI-D are affected if the following applies:

- System Software Version is 2286.07 thru 2286.14, AND
- GMA™ 1360D audio panels are installed, AND
- 3rd party cockpit voice recorder (CVR) is interfaced to the Garmin G1000 audio system.



NOTE

The following aircraft are excluded from the applicability of this service bulletin and will be the subject of a separate mandatory service bulletin:

- *G1000 NXi equipped King Air 200/300 series aircraft with the following:*
 - *Optional CVR installation*
 - *System Software version 2286.12 or earlier*
 - *GMA 1360D audio panels*
 - *Any of the following legacy units*
 - *GIA 63W Integrated Avionics Unit*
 - *GRS 77 AHRS*
 - *GDC 74B Air Data Unit*



NOTE

G1000 Legacy configurations (system software version 0985.01 and later) are not affected by this service bulletin regardless of 3rd party CVR installation status.



NOTE

G1000 NXi configurations (system software version 2286.01 thru 2286.06) are not affected by this service bulletin regardless of 3rd party CVR installation status.



NOTE

G1000 NXi configurations (system software version 2286.07 thru 2286.14) that DO NOT use a CVR or that use the GMA 1347D audio panels are also not affected by this service bulletin.

WARRANTY INFORMATION

This Service Bulletin is warranty reimbursable with a deadline of October 31, 2023.

Please contact your local Garmin Avionics Dealer (<http://www.garmin.com/dealers/>) for additional information or for questions regarding this notification. This service notification and associated bulletin/advisory product changes can only be implemented through Garmin's authorized dealer and service center network. This document is not a substitute for and cannot be used in lieu of the document(s) referenced above for airworthiness approval.