



SERVICE BULLETIN NO. MSB1078-103

I. TECHNICAL DETAILS

1.1 Category:

Mandatory

1.2 Airplanes affected:

G 115D	S/N 82014/D, 82052/D, 82067/D, 82078/D
G 115E	all S/N
G 115EG	all S/N (during series production as of S/N 82240)

1.3 Time of Compliance:

All instructions: next 100 hours inspection after receipt of material

1.4 Subject:

ATA-Code: 25-10
Baggage compartment cover

1.5 Reason:

Due to different modifications, including canopy sealing improvement an increase of the carbon monoxide concentration might be possible. To reduce the carbon monoxide concentration in the cockpit, the loud speaker cover, installed in the baggage compartment, must be replaced by a new closed cover plate.

1.6 Concurrent documents:

N/A

1.7 Approval Note:


These information or instructions relate to change no. IM 1078-84 which has been approved under the authority of JAA Design Organisation Approval No. LBA.NJA.008.

G 115D
G 115E
G 115EG

The technical information contained in this document has been approved under the authority of JAA Design Organisation Approval No. LBA.NJA.008.

1.8 Accomplishment/ Instructions

1. The following steps are to be taken:

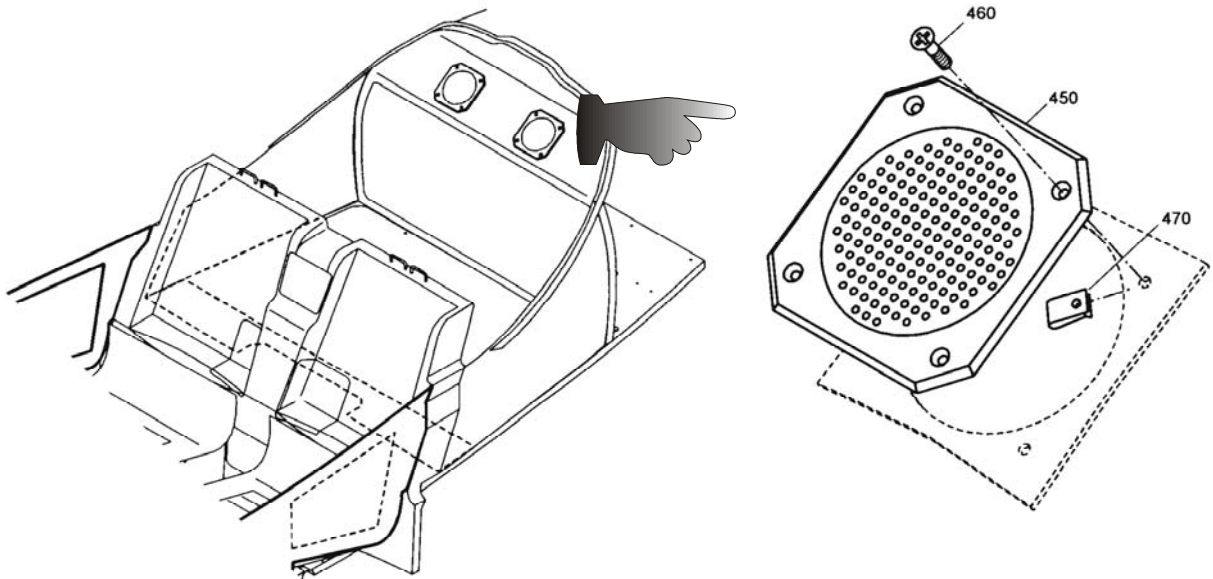

- remove screws (item 460, qty. 8) and remove loudspeaker covers (item 450)
- install new cover plate P/N 115E-2000.40 using screws (item 460)

2. The Illustrated Parts Catalogue will be amended during the next revision.

1.9 Repetitive Actions

None.

1.10 Mass (Weight) and CG:

N/A

G 115D
G 115E
G 115EG



II. PLANNING INFORMATION

2.1 Material & Availability:

- cover plate P/N 115E-2000.40, qty. 2

NOTE: The old loudspeaker covers must be returned to GROB

2.2 Special Tools:

N/A

2.3 Labour costs:

Modification: approx. 0,5 hours

2.4 Reference documents:

Airplane Maintenance Manual G 115D
Airplane Maintenance Manual G 115E
Airplane Maintenance Manual G 115EG
Illustrated Parts Catalogue G 115D
Illustrated Parts Catalogue G 115E
Illustrated Parts Catalogue G 115EG

2.6 Credit:

N/A

III. REMARKS

- 3.1** The correct execution of the instructions may be performed by a competent person/ an authorised aviation workshop and has to be certified in the logbook by an authorised inspector.
- 3.2** If you have sold your aircraft in the meantime, would you kindly pass this information on to the new owner and forward his address and aircraft S/N to us.
- 3.3** For questions and assistance please contact:

Rudi Vordermeier , Head of Product Support,
phone: +49 8268 998139
fax: +49 8268 998200
e-mail: productsupport@grob-aerospace.de

G 115D
G 115E
G 115EG